

The Old Schoolhouse,
Ringford,
Castle Douglas,
Kirkcudbrightshire,
DG7 2AL

Home Report



Selling Agent

Galbraith

DM HALL

The Old Schoolhouse,
Ringford,
Castle Douglas,
Kirkcudbrightshire,
DG7 2AL

Single Survey



DM HALL

Survey Report on:

Property Address

The Old Schoolhouse,
Ringford,
Castle Douglas,
Kirkcudbrightshire,
DG7 2AL

Reference

1041523

Customer Name

David Lawrie

Date of Inspection

2nd May 2025

Surveyor's name, qualifications and office

Michael P Churm BSc (Hon's) MRICS

DM Hall LLP Chartered Surveyors
11 Buccleuch Street
Dumfries
DG1 2AT

Tel: 01387 254318

email: dumfriesresidential@dmhall.co.uk

Prepared By

DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are

not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market value" The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Two Storey detached and extended house with ancillary former restaurant.
Accommodation	GROUND FLOOR: Entrance porch, hall, two reception rooms, living kitchen, utility room/shower room. FIRST FLOOR: Landing, five bedrooms, study/small single bedroom, bathroom with toilet.
Gross Internal Floor Area (m2)	195 SQM approximately
Neighbourhood and Location	The property is situated in a rural location. The property was originally constructed as a School and Schoolhouse. Part of the original building operated as a restaurant. The property overlooks agricultural land. Main facilities are available in surrounding towns.
Age	Built from around 1880
Weather	Inspected during dry and fine weather conditions.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. There are four chimney stacks serving the property, two to the front section of the property, of stone construction and two to the rear section of brick construction. Each of the stone chimney stacks has cement and lead flashings, chimney pots and

	<p>flue cowls. The brick built chimney stacks have lead flashings, chimney pots and flue cowls.</p>
Roofing including Roof Space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The property has a double pitch roof which to the front is clad in concrete tiles with a concrete ridge. The rear section is pitched and clad in slates with skew stones in place.</p> <p>Access to the front roof section was from the small front bedroom and revealed the construction to be of timber frame with sarking boards in place and fibreglass insulation laid.</p> <p>Access to the rear roof section is from the landing via a skylight. As the skylight is glazed and cracked and over the stairwell no safe access was possible. We understand that the glazing has been replaced with safety glass since our inspection.</p>
Rainwater Fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Roof gutters and downpipes are of PVC construction discharging to concealed gullies and conventional gullies.</p>
Main Walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are a combination of rendered stonework to the front and partly pointed stonework to the gables. The rear section is of solid brick construction externally pointed.</p>
Windows, External Doors and Joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p>

	<p>Doors and windows were not forced open.</p> <p>External windows are of uPVC construction with sealed unit double glazing. The main front access is from a uPVC door to the porch and rear access is via the restaurant.</p>
External Decorations	<p>Visually inspected.</p> <p>External stonework and brickwork has previously been painted.</p>
Conservatories and Porches	<p>Visually inspected.</p> <p>There is a porch to the front of the property with rendered masonry walls under a pitched concrete tile roof. The roof is flashed to the front elevation with cement fillet flashing.</p>
Communal Areas	<p>There are no communal areas.</p>
Garages and Permanent Outbuildings	<p>Visually inspected.</p> <p>To the side of the property and forming part of the original school, is a building which has most recently been used a restaurant. This has a pitched slate roof. No access was possible to the roof void. Main walls are part stone and partly solid brick. Windows are uPVC and double glazed. The rear access is shared with the residential property. Internally there is commercial style kitchen fitted with serving areas.</p> <p>In the car park area there is a detached building which has at one time been used for retail use. This has a pitched slate roof. The walls are solid brick.</p> <p>There are outbuildings to the rear of the residential property with a slate roof and solid brick walls.</p> <p>Timber sheds are not considered to be permanent outbuildings.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>There is a front garden area with former vegetable beds and an area of paving and lawn. External boundaries are formed in post and wire fencing and a hedge. There is a car park area to the rear, surfaced in asphalt.</p>
Ceilings	<p>Visually inspected from floor level.</p>

	<p>Ceilings are a combination of plasterboard and lath and plaster construction with decorative finishes applied.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>A combination of masonry and timber stud construction with decorative finishes applied. Wall finishes include tiling, tongue and groove boarding and wall panelling.</p>
Floors including Sub-floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>Ground floors are a combination of solid and suspended timber floors with carpets, tiling and vinyl floor covering. First floors are of suspended timber construction with fitted floor coverings in place.</p>
Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into, but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>In the kitchen there is a range of wall and base units with worktops. There is a central work island. There are timber skirting boards. Internal doors are of a panelled type. There are some built-in cupboards and wardrobes. There are timber staircases.</p>
Chimney Breasts and Fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>In the lounge area there is a fireplace with open grate and in the living room area a fireplace with wood burning stove. In two of the first floor bedrooms there are fireplaces.</p>

Internal Decorations	<p>Visually inspected.</p> <p>A combination of paper, paint and tiling as well as wall panelling.</p>
Cellars	<p>None.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>There is a mains electrical connection which is metered in the dining kitchen. Distribution where noted is in PVC and there are rewirable fuses and retrospectively fitted miniature circuit breakers.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>There is an LPG supply to the hob in the kitchen.</p>
Water, Plumbing and Bathroom Fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water is connected to the mains supply.</p> <p>There is a mains water connection with distribution where noted in copper and plastic. Sanitary fittings comprise in the kitchen a single drainer sink unit and in the shower room/utility room there is a flush toilet, wash hand basin and shower cubicle with electric shower fitting. In the main first floor bathroom there is a flush toilet, wash hand basin and panelled bath with separate shower cubicle and mixer fitting.</p> <p>Visible pipework is made with copper and PVC materials.</p>

Heating and Hot Water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property is heated by an oil fired central heating system from a boiler located in the utility room. This is a Worcester Camray boiler with distribution to water filled radiators most of which have thermostatic radiator valves.</p> <p>Hot water is provided from the central heating system and there is a hot water cylinder off the utility room. This incorporates insulation.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>There is a septic tank drainage system serving the subject property and restaurant and the tank is understood to be located in a neighbouring field.</p>
Fire, Smoke and Burglar Alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will be required to be installed prior to sale. This should be confirmed by your legal advisor.</p>
Any Additional Limits to Inspection	<p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p>

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

The property was occupied, fully furnished and all floors were covered. Consequently, my inspection of the flooring and other elements was restricted.


In accordance with Health and Safety Guidelines, I have not disturbed insulation or furniture and floor coverings have not been moved. Where present, personal effects within cupboards and wardrobes have not been moved, therefore limiting my inspection.

I was unable to inspect the sub floor area as no suitable access hatch was available.

My physical inspection of the roof void area was restricted due to insulation material. As a result, the roof void area was only viewed from the access hatch. No roof void

inspection of the roof void over the rear accommodation was possible due to the position of the access hatch.

Sectional Diagram showing elements of a typical house

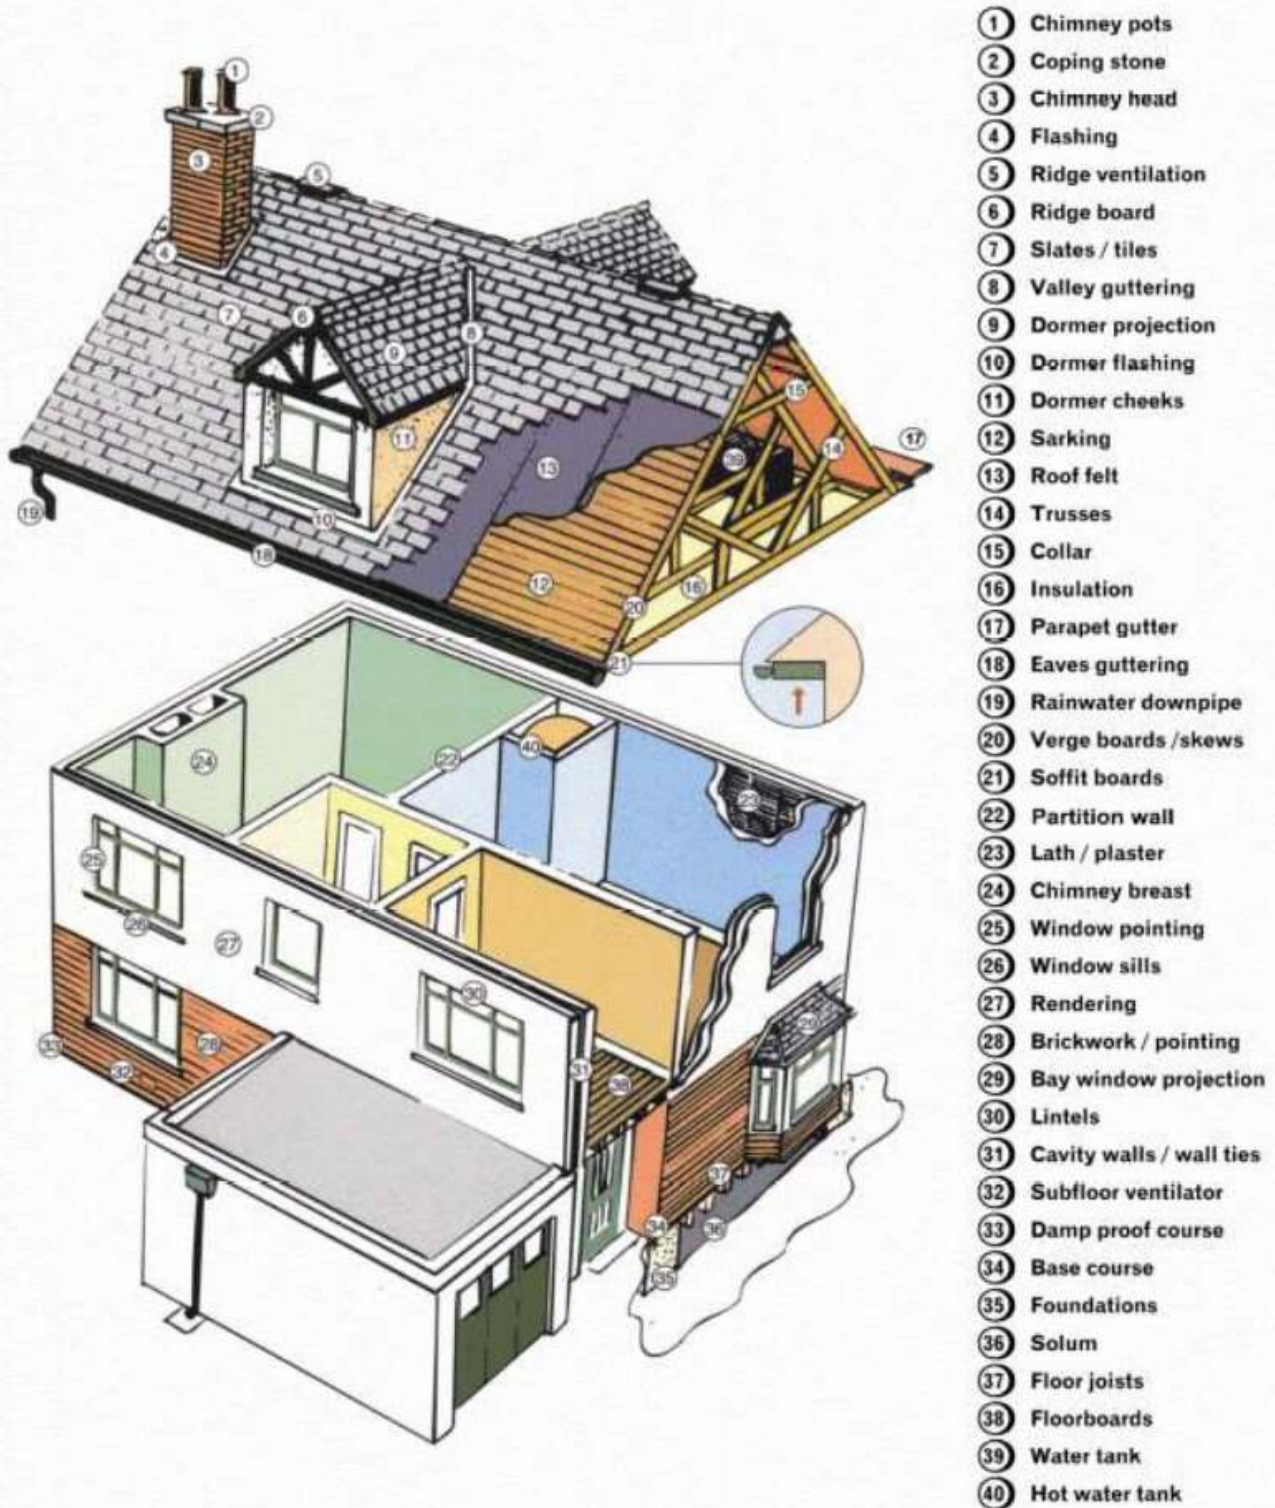

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, Rot and Infestation	
Repair Category	2
Notes	<p>Slightly high damp readings were recorded to a number of ground floor areas.</p> <p>There is evidence of condensation in various locations. This may be alleviated by a proper balance of heating and ventilation. This should be monitored. Further advice can be obtained from a specialist contractor.</p> <p>There is evidence of wood boring insect damage to a number of timbers which appears largely historic. Copies of any A specialist timber contractor can undertake treatment works and provide further advice.</p> <p>The seller advises that wood boring insect remedial work treatment has been instructed. Copies of guarantees should be transferred.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney Stacks	
Repair Category	1
Notes	<p>No significant defects evident.</p> <p>Chimney stacks are exposed to the worst weather conditions and defects in the chimney stacks can lead to dampness in the main building.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space

Repair Category	2
Notes	<p>There are valley gutters. These can be problematic (especially within older buildings), and maintenance should be undertaken regularly.</p> <p>There are a small number of chipped slates. It is understood that the roof has recently been repaired and loose and slipped slates reinstated.</p> <p>Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.</p> <p>There is evidence of wood boring insect damage. Please see comments under Dampness, Rot & Infestation.</p> <p>The skylight to the landing has some cracked glazing.</p>

Rainwater Fittings

Repair Category	1
Notes	No significant defects evident.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main Walls

Repair Category	1
Notes	No significant defects evident.

Windows, External Doors and Joinery

Repair Category	1
Notes	<p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional.</p> <p>The window units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.</p> <p>Windows and doors have been replaced in the past. Random windows and doors are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc.</p> <p>Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

External Decorations

Repair Category	1
Notes	No significant defects evident.

Conservatories and Porches

Repair Category	1
Notes	No significant defects evident. Cement fillet flashings between porch and front elevation will have a limited life.

Communal Areas

Repair Category	N/A
Notes	Not applicable.

Garages and Permanent Outbuildings

Repair Category	1
Notes	The restaurant building shows evidence of some weathered pointing externally. Internal plaster is cracked in places, but this does not appear of structural significance.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside Areas and Boundaries

Repair Category	1
Notes	No significant defects evident. The position of and responsibility for external boundaries should be confirmed by the solicitor.

Ceilings

Repair Category	1
Notes	No significant defects evident. Some ceilings area of an older style.

Internal Walls

Repair Category	1
Notes	No significant defects evident.

Floors including Sub-floors

Repair Category	1
Notes	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. There is evidence of wood boring insect damage to some ground floor timbers. See 'Dampness, rot and infestation' above.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Joinery and Kitchen Fittings	
Repair Category	1
Notes	<p>No significant defects evident.</p> <p>Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.</p> <p>The absence of handrails to staircases will not comply with current Building Standards.</p>

Chimney Breasts and Fireplaces	
Repair Category	1
Notes	<p>Flues should ideally be swept and tested on an annual basis.</p> <p>A wood burning stove has been installed in the living room. It is assumed that the installation complies with the Building Standards.</p> <p>If disused fireplaces are to be reopened, further advice should be sought to ensure that the chimney flue is intact and suitable for use.</p>

Internal Decorations	
Repair Category	1
Notes	No significant defects evident.

Cellars	
Repair Category	N/A
Notes	Not Applicable.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity	
Repair Category	2
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>A certificate of electrical safety has been seen which considers the wiring to be satisfactory, albeit dated in some areas.</p> <p>The electrical installation appears of mixed age with older style consumer unit and fittings. Further advice will be available from a NICEIC/SELECT registered electrician.</p>

Gas	
Repair Category	1
Notes	<p>There is an LPG supply to the hob in the kitchen.</p> <p>Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.</p>

Water, Plumbing and Bathroom Fittings	
Repair Category	1
Notes	No significant defects evident.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and Hot Water	
Repair Category	1
Notes	<p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>Boilers and central heating systems should be tested and serviced by an Oftec oil registered engineer on an annual basis to ensure their safe and efficient operation.</p> <p>Service records for the central heating system should be transferred.</p> <p>The boiler is of a older vintage.</p>

Drainage	
Repair Category	1
Notes	<p>No significant defects evident. Not tested.</p> <p>Details of the drainage system should be confirmed by the legal adviser including details of registration with SEPA</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	2
Chimney Stacks	1
Roofing including Roof Space	2
Rainwater Fittings	1
Main Walls	1
Windows, External Doors and Joinery	1
External Decorations	1
Conservatories and Porches	1
Communal Areas	N/A
Garages and Permanent Outbuildings	1
Outside Areas and Boundaries	1
Ceilings	1
Internal Walls	1
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	1
Chimney Breasts and Fireplaces	1
Internal Decorations	1
Cellars	N/A
Electricity	2
Gas	1
Water, Plumbing and Bathroom Fittings	1
Heating and Hot Water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The property has historically been utilised as a house with ancillary commercial usage.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and commercial use and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The restaurant is understood to have a separate EPC and the Home Report EPC refers only to the domestic accommodation.

The seller advises that wood boring insect remedial work treatment has been instructed. Copies of guarantees should be transferred.

Estimated Reinstatement Cost (£) for Insurance Purposes

One Million, One Hundred Thousand Pounds:
£1,100,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

To include the costs of demolition, site clearance, rebuilding, fees and VAT where applicable.

Valuation (£) and Market Comments

Three Hundred and Ninety-Five Thousand Pounds:
£395,000

This reflects current market conditions.

The valuation reflects the domestic property only. Any value attributed to the commercial elements have been disregarded from this valuation.

Against a backdrop of changing economic circumstances and changing interest rates, it is not

possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

Report author:	Michael P Churm BSc (Hon's) MRICS
Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors 11 Buccleuch Street Dumfries DG1 2AT Tel: 01387 254318 email: dumfriesresidential@dmhall.co.uk
Signed:	<i>Michael P Churm</i>
Date of report:	2nd May 2025

The Old Schoolhouse,
Ringford, Castle Douglas,
Kirkcudbrightshire, DG7 2AL

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: The Old Schoolhouse, Ringford, Castle Douglas, Kirkcudbrightshire, DG7 2AL

Date of Inspection: 2nd May 2025

Reference: 1041523

Location & Description

1. Location:

The property is situated in a rural location. The property was originally constructed as a School and Schoolhouse. Part of the original building operated as a restaurant. The property overlooks agricultural land. Main facilities are available in surrounding towns.

2. Description:

Two Storey detached and extended house with ancillary former restaurant.

3. Age:

Built from around 1880

4. Main Construction:

Walls: Stone and solid brick

Roof: Pitched slate

5. Accommodation:

GROUND FLOOR: Entrance porch, hall, two reception rooms, living kitchen, utility room/shower room.

FIRST FLOOR: Landing, five bedrooms, study/small single bedroom, bathroom with toilet.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 195

Gross external floor area: 246

7. Garage and Outbuildings:

Attached restaurant stone and brick with a slate roof. Brick built outbuildings.

Mortgage Valuation Report

Services / Roads

8 Main Service:

Water:	Yes:	<input checked="" type="checkbox"/>	No:	
Electricity:	Yes:	<input checked="" type="checkbox"/>	No:	
Gas:	Yes:		No:	<input checked="" type="checkbox"/>
Drainage:	Yes:		No:	<input checked="" type="checkbox"/>

For comments on non-mains services, see section 15.

8a. Heating:

Oil fired boiler.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: ☒ No: ☐

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None

Retention: Yes: ☐ No: ☒

Retention amount:

11. Subsidence, Settlement and Landslip:

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

12. General Condition:

The general condition of the property appears consistent with its age and type of construction.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes: ☒ No: ☐

Mortgage Valuation Report

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes: ☒

No: ☐

15. General Remarks:

Usual enquiries should be made of the local authority. A Property Enquiry Certificate should be obtained.

The property is assumed to be held in 'Absolute Ownership' and free from any onerous restrictions or obligations.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The property has historically been utilised as a house with ancillary commercial usage.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and commercial use and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The restaurant is understood to have a separate EPC and the Home Report EPC refers only to the domestic accommodation.

The seller advises that wood boring insect remedial work treatment has been instructed. Copies of guarantees should be transferred.

16. Comments on Mortgageability:

The property is currently mixed use and as such may only be suitable for specialist lenders.

The valuation reflects the domestic property only. Any value attributed to the commercial elements have been disregarded from this valuation.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Three Hundred and Ninety-Five Thousand Pounds: £395,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

One Million, One Hundred Thousand Pounds: £1,100,000

Mortgage Valuation Report

18. Declaration:

Signed:

Michael P Churm

Valuer's name and Qualifications: Michael P Churm BSc (Hon's) MRICS 0080549

Date: 7th May 2025

Office Address: DM Hall LLP Chartered Surveyors
11 Buccleuch Street
Dumfries
DG1 2AT

Tel: 01387 254318

email: dumfriesresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer

The Old
Schoolhouse,
Ringford, Castle
Douglas,
Kirkcudbrightshire,
DG7 2AL

Property Questionnaire

Property Questionnaire

Property Address:

The Old Schoolhouse, Ringford, Castle Douglas, Kirkcudbrightshire, DG7 2AL

Seller(s):

David and Caroline Lawrie

Completion Date of Property Questionnaire: 22/05/2025

Note for sellers.

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

Property Questionnaire

1. Length of ownership

How long have you owned the property? 19 years

2. Council Tax

Which Council Tax band is your property in? E

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	No	Allocated parking space	No	Driveway	Yes
Shared parking	No	On street	No	Resident permit	No
Metered parking	No	Other:	Gated private parking within the grounds		

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? No

5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? No

Property Questionnaire

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)?

No

If you have answered yes, please describe the changes which you have made:

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

No

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced?

(ii) Did this work involve any changes to the window or door openings?

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

Property Questionnaire

7. Central Heating

A. Is there a central heating system in your property?

Yes

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you, have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

Oil Boiler

If you have answered yes, please answer the 3 questions below:

B. When was your central heating system or partial central heating system installed?

pre 2006

C. Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

D. When was your maintenance agreement last renewed? (Please provide the month and year).

Property Questionnaire

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

9. Issues that may have affected your property

- a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

- b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

- a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	No	
Water mains/private water supply	Yes	Scottish Water
Electricity	Yes	Octopus
Mains Drainage	No	
Telephone	No	
Cable TV/Satellite	No	
Broadband	Yes	Plusnet

Property Questionnaire

- b. Is there a septic tank system at your property? Yes

If you have answered yes, please answer the two questions below:

- c. Do you have appropriate consents for the discharge from your septic tank? Yes

- d. Do you have a maintenance contract for your septic tank? No

If you have answered yes, please give details of the company with which you have a maintenance contract: No

11. Responsibilities for a Shared or Common Areas

- a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? No

If you have answered yes, please give details:

- b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? No

If you have answered yes, please give details:

- c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property? No

- d. Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? No

Property Questionnaire

If you have answered yes, please give details:

- e. **As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?** No

If you have answered yes, please give details:

- f. **As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)** No

If you have answered yes, please give details:

12. Charges associated with your property

- a. **Is there a factor or property manager for your property?** No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. **Is there a common buildings insurance policy?** No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. **Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.**

Property Questionnaire

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	No
(ii)	Roofing	No
(iii)	Central heating	No
(iv)	NHBC	No
(v)	Damp course	No

Property Questionnaire

(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No
------	--	----

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** No

If you have answered yes, please give details:

15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

- a. **Advising that the owner of a neighbouring property has made a planning application?** No
- b. **That affects your property in some other way.** No
- c. **That requires you to do any maintenance, repairs, or improvements to your property.** No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Energy Performance Certificate



DM HALL

Energy Performance Certificate (EPC)

Scotland

Dwellings

The Old Schoolhouse, Ringford, Castle Douglas, DG7 2AL

Dwelling type: Semi-detached house
Date of assessment: 29 May 2025
Date of certificate: 29 May 2025
Total floor area: 192 m²
Primary Energy Indicator: 268 kWh/m²/year

Reference number: 2117-1047-0235-5325-8224
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£9,183	See your recommendations report for more information
Over 3 years you could save*	£3,156	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Current	Potential
46	61

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (46)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Not energy efficient - higher running costs

Very environmentally friendly - lower CO₂ emissions



Current	Potential
38	59

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (38)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Not environmentally friendly - higher CO₂ emissions

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1872.00
2 Floor insulation (suspended floor)	£800 - £1,200	£162.00
3 Floor insulation (solid floor)	£4,000 - £6,000	£159.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
	Pitched, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, oil	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆	★★★★☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 70 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 13 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 5.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£8,067 over 3 years	£5,223 over 3 years	
Hot water	£696 over 3 years	£384 over 3 years	
Lighting	£420 over 3 years	£420 over 3 years	
Totals	£9,183	£6,027	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£624		
2 Floor insulation (suspended floor)	£800 - £1,200	£54		
3 Floor insulation (solid floor)	£4,000 - £6,000	£53		
4 Upgrade heating controls	£350 - £450	£113		
5 Solar water heating	£4,000 - £6,000	£77		
6 Replacement glazing units	£1,000 - £1,400	£132		
7 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£409		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

4 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

5 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	34,309	(5,238)	N/A	(8,793)
Water heating (kWh per year)	3,183			

Addendum

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Michael Churm
Assessor membership number:	EES/019285
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	11 Buccleuch Street Dumfries DG1 2AT
Phone number:	01387 254318
Email address:	michael.churm@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



DM Hall LLP, a Limited Liability Partnership registered
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,
Cumbria and the Southwest of England.

DM HALL